



MK 19 machine guns are suffering damage because gunners and armorers don't know or don't remember what helps or hurts the gun.

Easy does it with the rear sight. It's broken more than anything else on the MK 19. Keep the sight down when you're not firing. Put the sight bar down before you put the sight down. Push in

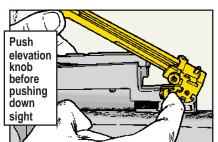


the elevation screw knob before you push down the sight. If you forget any of these steps, you may be sightless.

Guide the feed tray cover to the latched position. If you slam the cover shut, it chips or breaks the cover lock. Eventually, the cover can't be latched.

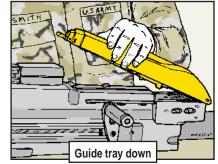

Slamming also knocks the primary drive lever out of alignment with the secondary drive lever. That causes feeding problems.

 Remember the tang. The feed tray cover pin has a tang that must be aligned with its hole's keyway when you install the pin. Make sure the pin is all the way in before closing the cover. Otherwise, you break the tang. The pin fits, but without the




Align tang with keyway before pushing in pin

PS 568

tang it works out during firing and makes the MK 19 unserviceable.

Support the bolt when you remove it. If you use the drive spring guides to pull out the bolt, the weight of the bolt bends the guides. Support the bolt with your other hand as you pull it out of the receiver.

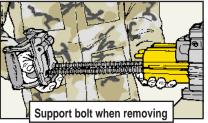


Do not dunk the sear assembly, bolt, or ogive plunger in cleaning solvent. They are sealed assemblies, but solvent still gets in and washes out their lubricant. Without lube, they will be ruined during firing. If you must use solvent to clean them, put the solvent on a rag or brush and use that to clean. Remember, anytime you clean with solvent you must lube the weapon again. Solvent not only cleans away carbon, but also lubricant. Make sure all solvent is wiped off before relubing.





PS 568 44 MAR 00

The flash suppressor is supposed to be slightly loose. If you or your armorer tighten or stake the suppressor, your MK 19 flunks inspection.

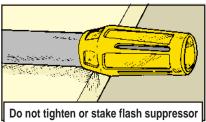

Leave the adjusting screw on the back of the bolt assembly alone. Messing with it messes up your MK 19's timing and could cause it to not fire.

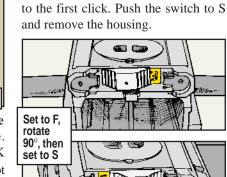

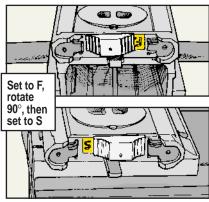

Remove the sear housing correctly. If you remove the housing with the

sear set to F, the sear comes apart and things like the spring can be lost. With

the sear set to F, rotate the housing 90°

